


Instruction Sheet

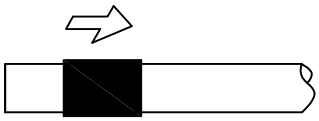

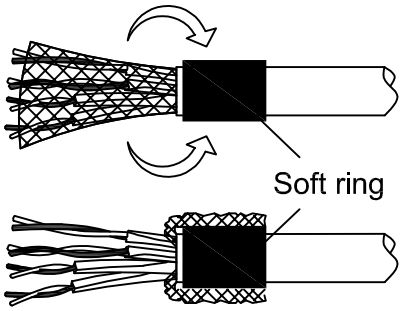

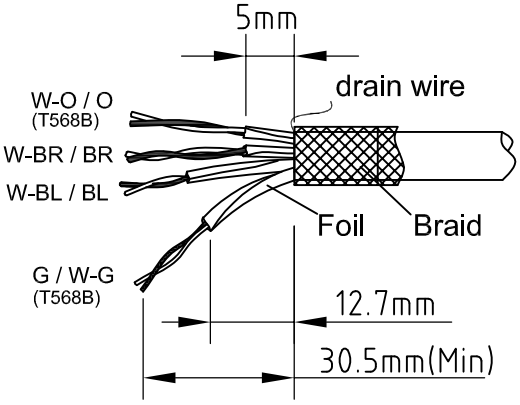

***Option**


When the cable OD is smaller than 6.5mm,insert the cable into the soft ring before managing the wires

*The soft ring should be covered by the braid

Step 1 :


①Strip off cable the jacket for at least 30.5mm and retain 12.7 & 5mm of foil from the jacket end.

②pull back the braid and then wrap the drain wire around it.

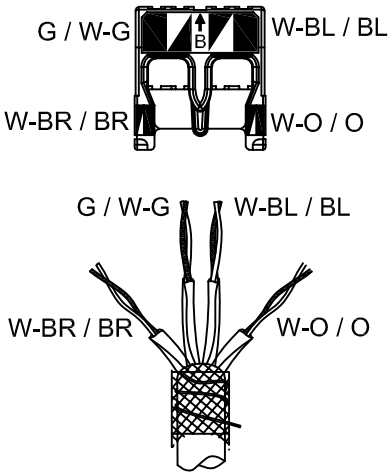


Step 2 :

Put the wires through the wire management per-the color code.

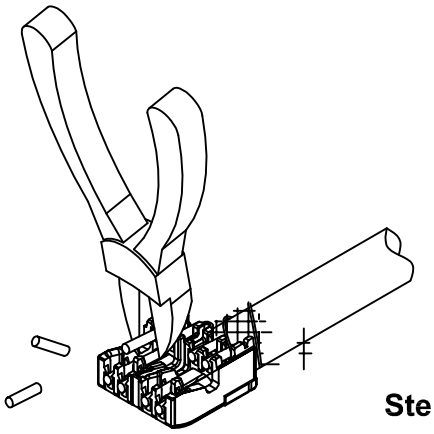

Step 3 :

Trim excess wires.

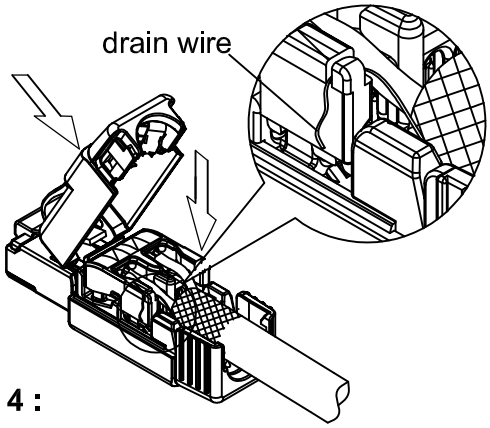


Step 4 :

Assemble the wire management. Then press on the cover to engage it with the base housing.

* (A tool will be required for termination if the cable is too thick)


* (When the cable grounding consists of only a drain wire,put the wire into projecting slot of the wire management as shown.)

Disassembly Instruction:

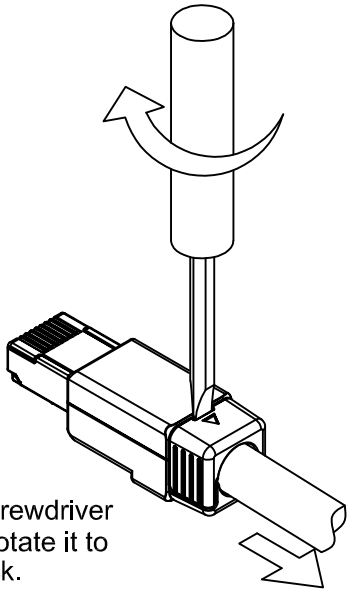

Step 1 :

Insert a slotted screwdriver into the slot and rotate it to open the base lock.

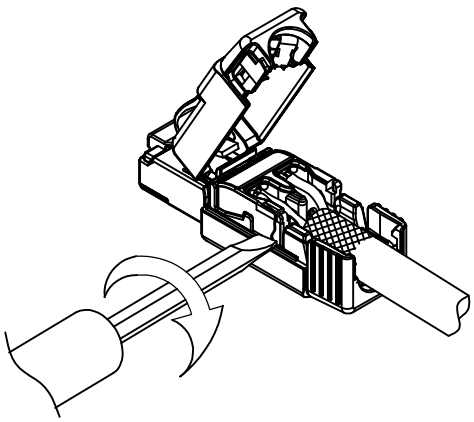

Step 2 :

Insert a slotted screwdriver into the slot and rotate to open the wire management.